



The GM 8-Speed TCC Shudder Solution

THE RESULTS **ARE CLEAR**

Lubegard Platinum ATF Protectant significantly reduces torque converter clutch shudder and slippage.

General Motors has issued several technical service bulletins pertaining to torque converter clutch shudder issues in two of their 8-Speed transmissions; 8L45 & the 8L90. This problem currently affects 11 different models across 3 different OEM manufacturers between the model years 2015 and 2019. GM's solution to this problem is lengthy &complicated, requiring 20 liters of ATF be flushed through the system to replace as much fluid as possible, yet still has not corrected the issue in some cases. With these vehicles approaching the end of their limited powertrain warranties, you can expect to see an increase of these vehicles in your shop.

We're here today to offer you a better, less complicated, and less expensive way to service these transmissions successfully with fewer comebacks and customer complaints.

We used our state-of-the-art Falex Multispecimen testing platform to develop conditions that caused shudder to occur between an automatic transmission friction plate and steel plate when lubricated with GM's recommended ATF specified in their technical service bulletins. We then eliminated the shudder under the same conditions by adding **Lubegard Platinum High-Performance ATF Protectant** to the test ATF at the treat rate of 2 fluid ounces per quart. An added advantage of the **Lubegard Platinum High-Performance ATF Pro**tectant was control and stabilization of the friction at a constant level throughout the tests.

When your customer is suffering from TCC shudder and/or slippage, you can help them avoid the expensive replacement of their OEM ATF by simply adding 2 bottles of Lubegard Platinum ATF Protectant, or, if the customer insists on replacement, you can avoid recurrence of the TCC shudder with the addition of 2 fluid ounces per quart of Lubegard Platinum High-Performance ATF Protectant.




LUBEGARD® PLATINUM

can be added to your existing ATF (Mobil1 **HP LV or Dexron HP)** at a treat rate of 2 oz per quart of ATF or 2 bottles of 10-oz. LUBEGARD PLATINUM per transmission to the total capacity (including torque converter) without the need to flush the transmission.

> See chart on back for capacities and recommended amount to add.

FRICTION PLATE SHUDDER TEST:

OEM ATF Shudder Test With and Without Lubegard Platinum

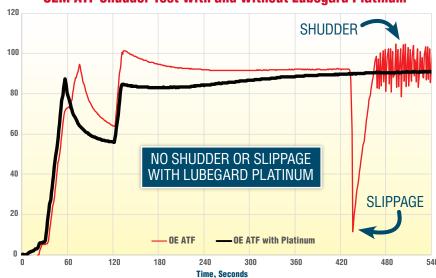

RECOMMENDATIONS:

Lubegard Platinum ATF Protectant when used at 2 oz-per-quart treat rate (2 bottles per transmissions) extends frictional durability and reduces slippage in GM 8-Speed transmissions.







FOR THE RIGHT FLUID AND THE RIGHT SOLUTIONS

SERVICE COST COMPARISON

Save money with LUBEGARD

There's no need for an Expensive & Wasteful fluid change service
Just add LUBEGARD PLATINUM!*

Total Cost of Service (does not include labor)

OPTION 1	OPTION 2		
OE RECOMMENDED SOLUTION	LESS EXPENSIVE SOLUTION		
Total flush and fill using 20 bottles of expensive ATF	Add 2 bottles (20 oz) of LUBEGARD PLATINUM		
OEN OEN OF PLUI PLUID	OM Midd Aburnative A AT Booter Feater, Finner Shifts TOO INTER SHOOLE SUITON SHITT PRACHESISM 10 FL OZ (296 mL) 10 FL OZ (296 mL)		
\$259.80	\$37.98		

*Note that LUBEGARD PLATINUM is compatible with GM recommended ATF and can be added at the time of service or as a top off to eliminate shudder and slippage

MODEL	MAKE	YEARS	TRANSMISSION	TOTAL FILL Quarts	RECOMMENDED AMOUNT OF LUBEGARD PLATINUM
CADILLAC	ATS	16-19	8L45/8L90	10.9	2 bottles (20 ounces)
CADILLAC	ATS	16-19	8L45/8L90 w/cooler	11.4	2 bottles (20 ounces)
CADILLAC	CTS	16-18	8L45/8L90	10.9	2 bottles (20 ounces)
CADILLAC	CTS	16-18	8L45/8L90 w/cooler	11.4	2 bottles (20 ounces)
CADILLAC	CT6	16-18	8L45/8L90	10.9	2 bottles (20 ounces)
CADILLAC	СТ6	16-18	8L45/8L90 w/cooler	11.4	2 bottles (20 ounces)
CADILLAC	Escalade	15-16	8L90	10.9	2 bottles (20 ounces)
CADILLAC	Escalade	15-16	8L90 w/cooler	11.4	2 bottles (20 ounces)
CHEVY	Camaro	16-19	8L45	10.9	2 bottles (20 ounces)
CHEVY	Camaro	16-19	8L45w/cooler	11.4	2 bottles (20 ounces)
CHEVY	Colorado	17-19	8L45	10.9	2 bottles (20 ounces)
CHEVY	Colorado	17-19	8L45w/cooler	11.4	2 bottles (20 ounces)
CHEVY	Corvette	15-19	8L90	10.9	2 bottles (20 ounces)
CHEVY	Silverado	15-18	8L90	10.9	2 bottles (20 ounces)
GMC	Canyon	17-19	8L45	10.9	2 bottles (20 ounces)
GMC	Canyon	17-19	8L45w/cooler	11.4	2 bottles (20 ounces)
GMC	Sierra	15-18	8L90	10.9	2 bottles (20 ounces)
GMC	Yukon	15-17	8L90	10.9	2 bottles (20 ounces)



